

Cobham SATCOM

Lundtoftegaardsvej 93 D
2800 Kgs. Lyngby
Denmark

T: +45 39 55 88 00

F: +45 39 55 88 88

Date: April - 2023

Document Number: 95-183421-E

EXPLORER® 323
Software Release version 1.03

Subject:

Please be informed that a new software version 1.03 build 6 has been released.
This version is with a single bug fix based on previous ver. 1.02.

Priority:

LOW: It is recommended to apply this change to EXPLORER 323 hardware revision A.35 and higher. Revision A.34 and lower is not affected. See hardware label on the bottom on the EXPLORER 323 unit.

Changes from software ver. 1.02 to ver. 1.03 build 6:**New Features:**

N/A

Updated Features:

N/A

Bug fixes:

Problem with Status LED that do not switch off but stay YELLOW flashing when ignition on car/truck is turned off. The terminal is in idle mode even though status LED show different.

Action:


Download & extract file **EXPLORER323_ver_1.03.zip** located at Cobham SATCOM Sync partner login: <https://sync.cobham.com/> - or at the Cobham SATCOM Sync Support section: <https://sync.cobham.com/satcom/support>.

To update the software in the EXPLORER 323 via the web interface, do as follows:


1. Open the web interface at address <http://192.168.0.1> or <http://ut.bgan> and enter the Control panel.




3. Click Support.

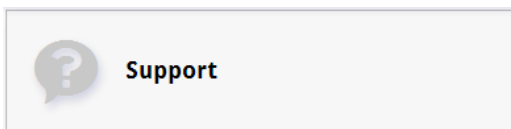


4. Click Update Software.

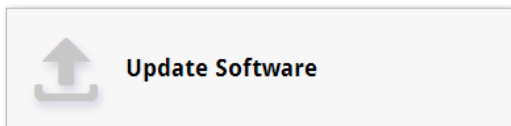

5. Click Update software.

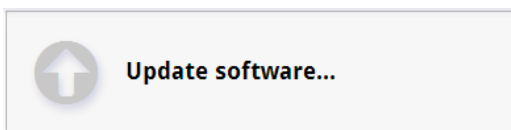


6. Browse to the new software version and click Open. The software file has the extension ".tif". The EXPLORER 323 will upload the file and start updating the software.

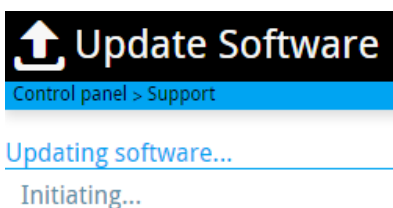

Important! – Do not remove power to the terminal during the update process!!


The EXPLORER 323 now reboots to continue the update process.

Shortly after the reboot, the update process can be monitored in the web interface at <http://192.168.0.1> (default) or <http://ut.bgan> by login as 'user'.

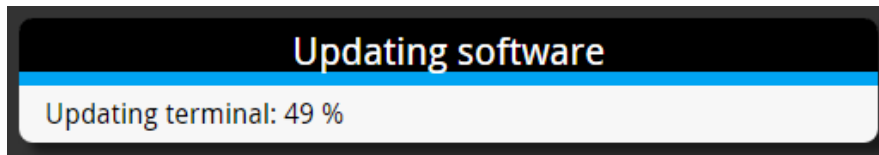

Checking web interface for correctly loaded software version 1.03 Build number 6:

7. Enter Control panel as in step 1 - and Click Support.

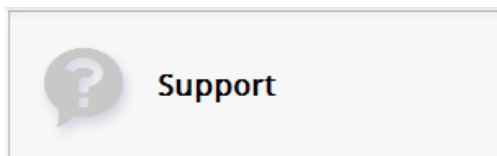

8. Click About.



Remote software upgrade:

You can initiate a remote software upgrade with an AT command, either from the command interface or encapsulated in an SMS (ATCO command).

For detailed syntax and parameters, see Appendix B of the User & Installation Manual.

AT_IGETFW=1

Will command the terminal to get the software from the default FTP server via default APN and download and then upgrade the software in the terminal.

Note: With a M2M subscription you can use Inmarsat's M2M FUP server (default FTP server for software upgrade like in example above). This is not available for Non-M2M subscriptions.

Cobham SATCOM

Customer Service